CIVIL ENGINEERING ENVIRONMENTAL

SURVEYING

LANDSCAPE ARCHITECTURE
GEOTECHNICAL

STORMWATER MANAGEMENT MAINTENANCE MANUAL

248 Stickles Pond Road Block 151 Lot 21 Andover Township Sussex County, New Jersey

Prepared For: BHT Properties Group 5081 SW 48th Street, 1023 Davie, Florida 33314

Wayne J. Ingram, P.E. New Jersey Professional Engineer License No. 24GB04258200



Headquarters

140 West Main Street | High Bridge, NJ 08829 T: 908.238.0544



belebrating

TABLE OF CONTENTS

PART I - MAINTENANCE

1.	List of Stormwater Management Measures	3
2.	Location Map	4
3.	Description of Stormwater Management Measures	5
4.	Preventative and Corrective Maintenance Action Plan	7
5.	Inspection and Logs of All Preventative and Corrective Maintenance	10
6.	Maintenance Personnel, Equipment, Tools, and Supplies	10
7.	Cost Estimate	11
	Safety Measures and Procedures	
9.	Training Plan and Records	13
10.	Annual Evaluation of the Effectiveness of the Plan	15
11.	Documents	16

PART II - FIELD MANUALS AND MAINTENANCE RECORDS

Field Manual for Surface Infiltration Basin (SWM-A)
Field Manual for Surface Infiltration Basin (SWM-B1)
Field Manual for Surface Infiltration Basin (SWM-B2)
Field Manual for Surface Infiltration Basin (SWM-D)
Field Manual for Surface Infiltration Basin (SWM-G1)
Field Manual for Surface Infiltration Basin (SWM-H)
Maintenance Logs and Inspection Records



PARTY RESPONSIBLE FOR MAINTENANCE:

BHT Properties Group Address:5081 SW 48 th Street. 1023, Davie Contact Person(s):	
Phone:	
This plan is recorded in	
Deed Book # Page # with	County Clerk on Date
Last Revised on//	



PART I - MAINTENANCE PLAN

1. LIST OF STORMWATER MANAGEMENT MEASURES


The stormwater management measures incorporated into this development are listed below. The corresponding Field Manuals for the stormwater management measures are located in Part II of the Maintenance Plan.

Type of Stormwater Management Measure	BMP No.	Location Description	State Plan Coordinates / Lat., Long.
Surface Infiltration Basin	SWM-A	Southern Section of Site	N(Y): 797,322.43 E(X): 419,229.886
Surface Infiltration Basin	SWM-B1	Middle Section of Site	N(Y): 798,325.44 E(X): 420,540.19
Surface Infiltration Basin	SWM- B2	Middle Section of Site	N(Y): 798,476.15 E(X): 420,387.26
Surface Infiltration Basin	SWM-D	Western Section of Site	N(Y): 797,593.22 E(X): 418,911.61
Surface Infiltration Basin	SWM- G1	Northern Section of Site	N(Y): 799,480.665 E(X): 420,353.378
Surface Infiltration Basin	SWM-H	Northern Section of Site	N(Y): 799,928.706 E(X): 420,896.96



2. LOCATION MAP

The map below shows the proposed site improvements and stormwater management measures for the subject property.

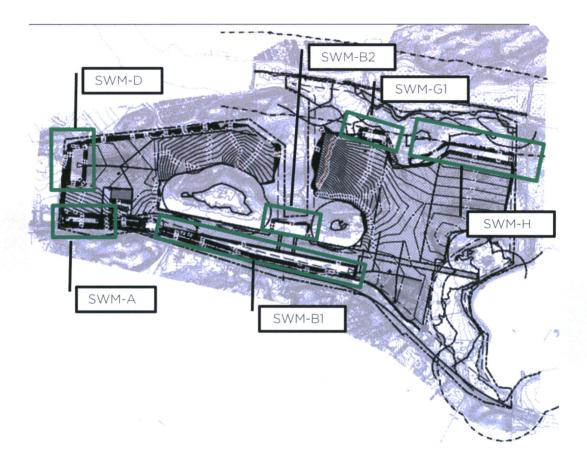



DESCRIPTION OF STORMWATER 3. MANAGEMENT MEASURES

Surface Infiltration Basin (SWM-A)

Design storm:

- Design Purposes:

 - Water Quality, Quantity, and Recharge
 1.25 inches in 2 hours; Max WSE: 592.76 Drain Time: 1.2 hours
 - 2-year storm in 24 hours (3.24 inches)
 - Max WSE: 593.28 Drain Time: 3.5 hours
 - o 10-year storm in 24 hours (4.73 inches)
 - Max WSE: 593.92 Drain Time: 5.2 hours
 - 100-year storm in 24 hours (7.51 inches)
 - Max WSE: 595.05 Drain Time: 8.5 hours
- Dimensions: 259' (Length) x 41' (Width) x 5.0' (Depth)

Surface Infiltration Basin (SWM-B1)

Design storm:

- Design Purposes:
 - Water Quality, Quantity, and Recharge 0
 - 1.25 inches in 2 hours; Max WSE: 598.62
 - Drain Time: 1.1 hours
 - 2-year storm in 24 hours (3.24 inches)
 - Max WSE: 599.19 Drain Time: 3.6 hours
 - 10-year storm in 24 hours (4.73 inches)
 - Max WSE: 599.93 Drain Time: 5.7 hours
 - 100-year storm in 24 hours (7.51 inches)
 - Max WSE: 601.18 Drain Time: 9.7 hours
- Dimensions: 1,274' (Length) x 55' (Width) x 4.0' (Depth)



Surface Infiltration Basin (SWM-B2)

Design storm:

- Design Purposes:

o Water Quality, Quantity, and Recharge

o 1.25 inches in 2 hours; Max WSE: 598.46 Drain Time: 0.8 hours

o 2-year storm in 24 hours (3.24 inches)

Max WSE: 598.82 Drain Time: 2.4 hours

o 10-year storm in 24 hours (4.73 inches)

Max WSE: 599.26 Drain Time: 3.7 hours

o 100-year storm in 24 hours (7.51 inches)

Max WSE: 600.77 Drain Time: 6.2 hours

- Dimensions: 12' (Length) x 12' (Width) x 8.38' (Depth)

Surface Infiltration Basin (SWM-D)

Design storm:

- Design Purposes:

Water Quality, Quantity, and Recharge1.25 inches in 2 hours;

o 1.25 inches in 2 hours; Max WSE: 599.41 Drain Time: 1.7 hours

o 2-year storm in 24 hours (3.24 inches)

Max WSE: 600.54 Drain Time: 5.1 hours

o 10-year storm in 24 hours (4.73 inches)

Max WSE: 601.84 Drain Time: 7.7 hours

o 100-year storm in 24 hours (7.51 inches)

Max WSE: 604.11 Drain Time: 12.5 hours

- Dimensions: 249' (Length) x 95' (Width) x 7.0' (Depth)

Surface Infiltration Basin (SWM-G1)

Design storm:

- Design Purposes:

o Water Quality, Quantity, and Recharge

o 1.25 inches in 2 hours; Max WSE: 597.21 Drain Time: 2.0 hours

o 2-year storm in 24 hours (3.24 inches)

Max WSE: 598.13 Drain Time: 6.1 hours

o 10-year storm in 24 hours (4.73 inches)

Max WSE: 599.14 Drain Time: 9.4 hours

o 100-year storm in 24 hours (7.51 inches)

Max WSE: 600.64 Drain Time: 15.7 hours

- Dimensions: 322' (Length) x 32 (Width) x 5.0' (Depth)



Surface Infiltration Basin (SWM-H)

Design storm:

- Design Purposes:

o Water Quality, Quantity, and Recharge

o 1.25 inches in 2 hours; Max WSE: 596.75 Drain Time: 1.2 hours

o 2-year storm in 24 hours (3.24 inches)

Max WSE: 597.36 Drain Time: 3.7 hou

Drain Time: 3.7 hours
o 10-year storm in 24 hours (4.73 inches)

Max WSE: 598.16 Drain Time: 5.7 hours

o 100-year storm in 24 hours (7.51 inches)

Max WSE: 599.63 Drain Time: 9.7 hours

Dimensions: 771' (Length) x 52' (Width) x 4.0' (Depth)

4. PREVENTATIVE AND CORRECTIVE MAINTENANCE ACTION PLAN

Preventative Maintenance Actions

Frequency	Preventative Maintenance Actions	Stormwater Measures/ No.
Monthly	Trim grass and vegetation to maintain a neat and orderly appearance. Inspect for unwanted tree and shrub growth. Inspect bottom of basins and remove sediment and debris as required.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Quarterly	Inspect inflow points, manholes, cleanouts, structure interior, and structural integrity. Trash and debris should be removed immediately as required. Also applies after major storms in excess of 1 inch of rainfall.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Bi-Annually	Inspect vegetation for health, density and desired diversity. If 50% of the vegetation is substandard the entire basin shall be revegetated. Inspect vegetated areas for evidence of scour and erosion, repair and necessary. Inspect all components for	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H



	cracking subsidence erosion, deterioration. Make necessary repairs or corrective action.	
Quarterly	Inspect all components for clogging and excessive debris and sediment accumulation. Sediment removal should take place when the drywell is thoroughly dry. Trash and debris should be removed immediately and disposed of at the proper sites.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Annually	Inspect components for cracking, subsidence, spalling, erosion and deterioration	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Bi-Annually	Inspect components expected to receive or trap debris for clogging.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Seasonal	Grass within the swale should be maintained to fall within the required grass height range of 3 to 6 inches. Moving and trimming should be performed on a regular schedule based on site conditions. Grass clippings should be removed or maintain small to avoid the facilitation of mosquito breeding.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Quarterly	Remove weeds and other unwanted vegetation growth in accordance with the landscape plan included with the development drainage for the project site.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Annually	Inspect outflow for evidence of scour and erosion, repair as necessary. Inspect for unwanted vegetative growth. Inspect all structural components for cracking, subsidence, spalling, erosion, and deterioration. Make necessary repairs or corrective action. Inspect discharge location (overflow) and ensure stability of grate and remove trash/debris.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Quarterly	Inspect each storm water inlet for trash, sediment and debris. Remove as necessary. Ensure roof leader drains are functioning properly.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Annually	Inspect inlet for structural integrity and make any necessary repairs as required.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H
Unscheduled	Quick inspection after every 1" rain	
All Times	No heavy equipment all be permitted on the basin surface.	SWM-A, SWM-B1, SWM-B2,S WM-D, SWM-G1, SWM-H



Corrective Maintenance Actions

Potential Corrective Maintenance Actions	Stormwater Management Measures/No.
Repair/ Replacement of outlet structure: The maximum 'allotted time' for a detention system to drain is 72 hours. If at any time the systems fail to drain within the 'allotted time', immediate corrective measures shall be employed.	SWM-B1

- The roof leader drain collection system should be inspected semiannually to confirm proper operation during storm conditions; check for clogging.
- Vegetation health should be inspected biweekly during the first growing season or until vegetation is established. Once, established, these inspections should be continued at least twice annually. Vegetative cover should be maintained at 85%, and if the area vegetation has greater than 50% damage, the area should be reestablished in accordance with the original specifications. All vegetation deficiencies should be addressed without the use of fertilizers and pesticides whenever possible. At least one full growing season should have elapsed prior to strip functioning as part of the stormwater management system.



5. INSPECTION AND LOGS OF ALL PREVENTATIVE AND CORRECTIVE MAINTENANCE

Inspection Checklists in the Field Manual for the stormwater management measures on this site include:

• Surface Detention Basin Field Manual

The logs of all inspections, and both preventative and corrective maintenance performed should be attached in the "Maintenance Logs and Inspection Records" section. See Part II of the Maintenance Plan

6. MAINTENANCE PERSONNEL, EQUIPMENT, TOOLS, AND SUPPLIES

Maintenance Personnel/Equipment/Tools/Supplies

Personnel/Equipment/Tools Name	Quantity
Access cover lifting tool	2
Gloves and safety shoes	2 per employee
Flashlight	2
Safety Cones and/or caution tape	10
Hard Hats and Safety Glasses	1 per employee
Proper Safety Equipment for confined space entry	As needed



COST ESTIMATE

General cost for routine maintenance (e.g., quarterly maintenance)

Cost Type	Cost Per Task				
Trim and Mow Grass and Vegetation in stormwater management areas	\$500	8	1	\$4,000	
Inspect basin outlets control structures, inlets, manufactured treatment device, and cleanouts for trash, debris, and sediment (clean/remove as necessary)	\$1,600	4	6	\$6,400	
Inspect roof leaders and gutters for trash, debris, and sediment (clean/remove as necessary)	\$450	Approx. 12	1	\$5,400	

General cost - unscheduled maintenance in a year (e.g., inspection after 1 inch of rain)

The frequency of large storm events that require routine maintenance varies from year to year. Therefore, it is possible that the estimated quantities of tasks shown above will vary. In these cases, the 'Cost per Task' column may be used to estimate single unscheduled tasks.

8. SAFETY MEASURES AND PROCEDURES

As per NJDEP BMP Manual, procedures and equipment are required to protect the safety of inspection and maintenance personnel.

Qualification for Performing Maintenance in Special Circumstances

Maintenance tasks that require the entry of inlet/outlet structures, manholes, or MTDs are required to be performed by qualified personnel that have the necessary Occupational Safety and Health Administration (OSHA) Confined-Space Entry training and certification.



Safety Procedures

Maintenance personnel shall follow all other procedures required by local, state. and federal laws and regulations, and the safety instructions provided by the equipment or device manufacturers.

Training Plan and Records

As per NJDEP BMP Manual Ch. 8 (February 2004), maintenance training begins with a basic description of the purpose and function of the overall stormwater management measure and its major components. Such understanding will enable maintenance personnel to provide more effective component maintenance and more readily detect maintenance-related problems. Depending on the size, character, location, and components of each stormwater management measure, maintenance personnel may also require training in specialized inspection and maintenance tasks and/or the operation and care of specialized maintenance equipment. Training should also be provided in the need for and use of all required safety equipment and procedures.

Safety Training

Types of Training:

- Mandatory Stormwater Management Basic Training and Field Manual Usage Training for new maintenance crews
- Occupational Safety Training
- Subcontractor training, if applicable

Content of Training:

- Stormwater Management Basic Training Purposes and Functions of BMPs. Example Training Material:
 - o NJDEP Stormwater BMP Manual, Chapter Nine: Structural Stormwater Management Measures
 - Chapter 9.1 Detention Systems
 - Chapter 9.2 Constructed Wetlands Chapter 9.3 Dry Wells

 - Chapter 9.4 Extended Detention Basins
 - Chapter 9.5 Infiltration Basins
 - Chapter 9.6 Manufactured Treatment Devices
 - Chapter 9.7 Pervious Paving Systems
 - Chapter 9.8 Rooftop Vegetated Cover
 - Chapter 9.9 Sand Filters
 - Chapter 9.10 Vegetative Filter Strips
 - Chapter 9.11 Wet Ponds
 - Chapter 9.12 Grass Swales
 - Chapter 9.13 Subsurface Gravel Wetlands

More training information is available at NJ Stormwater.org (http://www.nj.gov/dep/stormwater/training.htm)

Vegetation Care. Example Training Material:



- NJDEP Stormwater BMP Manual, Chapter Seven: Landscaping (provides information on vegetation and landscaping for stormwater management measures)
- o Other
- Field Manual Usage Training. Example Training Material:
 - o Field Manuals attached to this Maintenance Plan
 - o Other
- Equipment and Tools Operation Training. Example Training Material:
 - o Equipment or tool manufacturer's Operation & Maintenance Manual
 - o Other
- Occupational Safety Training. Example Training Material:
 - o OSHA Training
 - Equipment or tool manufacturer's Operation & Maintenance Manual
 - o Other

9. TRAINING PLAN AND RECORDS

I. Training Plan

Types of Training

- Mandatory Stormwater Management Basic Training and Field Manual Usage Training for new maintenance crews
- Occupational Safety Training
- Subcontractor training, if applicable

Content of Training

- Stormwater Management Basic Training
 - Purposes and Functions of BMPs

Example Training Material

- NJDEP Stormwater BMP Manual, Chapter Nine: Structural Stormwater Management Measures
 - Chapter 9.4 Extended Detention Basins
 - Chapter 9.7 Pervious Paving Systems
 - Chapter 9.10 Vegetative Filter Strips
 - Chapter 9.12 Grass Swales

More training information is available at NJ Stormwater.org (http://www.nj.gov/dep/stormwater/training.htm)

Vegetation Care

Example Training Material

- NJDEP Stormwater BMP Manual, Chapter Seven: Landscaping
- (provides information on vegetation and landscaping for stormwater management measures)
 - Other



Field Manual Usage Training

Example Training Material

- Field Manuals attached to this Maintenance Plan
- Other
- Equipment and Tools Operation Training

Example Training Material

- Equipment or tool manufacturer's Operation & Maintenance Manual
- Other
- Occupational Safety Training

Example Training Material

- OSHA Training
- Equipment or tool manufacturer's Operation & Maintenance Manual
- Other

II. Training Records

Training attendance sheets should be attached by the responsible party after each training.



10. ANNUAL EVALUATION OF THE EFFECTIVENESS OF THE PLAN

Per N.J.A.C. 7:8-5.8(g), the Responsible Party designated at the beginning of this report shall evaluate the effectiveness of the maintenance plan at least once per year and adjust the plan as needed.

The Responsible Party shall evaluate the effectiveness of the maintenance plan by comparing the maintenance plan with the actual performance of the maintenance. The following items shall be evaluated at a minimum:

- Whether inspections have been performed as scheduled;
- Whether preventive maintenance has been performed as scheduled;
- Whether the frequency of preventative maintenance needs to increase or decrease;
- Whether the planned resources were enough to perform the maintenance;
- Whether repairs were completed on time;
- Whether the actual cost was consistent with the estimated cost;
- Whether inspection, maintenance, and repair records have been kept.

If actual performance of these items has deviated from the maintenance plan, the Responsible Party should find the causes and implement solutions in a revised maintenance plan.

The following shall be provided to the township engineer prior to April 1st of each year:

- All inspection reports of prior years,
- Description of all maintenance performed on all components of SWM system during prior year.

Annual Evaluation Records

Evaluator(s)	Date of Evaluation	Decision



11. DOCUMENTS

The following documents shall be attached prior to issuance of Certificate of Occupancy:

Transfer Agreement

As per N.J.A.C. 7:8-5.8(b), if the maintenance plan identifies a person other than the developer as having the responsibility for maintenance, the plan shall include documentation of such person's agreement to assume this responsibility, or the developer's obligation to dedicate a stormwater management facility to such person under an applicable ordinance or regulation.

Deed

As per N.J.A.C. 7:8-5.8(d), if the person responsible for maintenance is not a public agency, the maintenance plan and any future revisions shall be recorded upon the deed of record for each property on which the maintenance described in the maintenance plan must be undertaken.

As-Built Drawings with Drainage Plans

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), as-built construction plans of the stormwater management measure and copies of pertinent construction documents, such as laboratory test results, permits, and completion certificates should be included in this Maintenance Plan.

Landscaping Plan for the Stormwater Management Measures

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), if there is a Landscaping Plan for the stormwater management measures, it should be included in this Maintenance Plan.

Permeability Test/Infiltration Test Report

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), if a permeability test or infiltration test is required and available, the reports for pre-construction and post-construction testing should be included in this Maintenance Plan.

Groundwater Mounding Analysis

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), if a groundwater mounding analysis is required and the groundwater mounding analysis was performed, a copy of the analysis should be included in this Maintenance Plan.

Soil Boring Logs

As per NJDEP BMP Manual Ch.8 (Feb., 2004), if any soil borings were taken prior to construction, a copy of the soil boring logs should be included in this Maintenance Plan.

Local, State, Federal Permits

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), local, state, or federal permits related to the stormwater management measures for this development should



be included in this Maintenance Plan. See Cost Estimate Section of This Maintenance Plan for more information.

The requirement to obtain State permits depends on specific circumstances, such as, but not limited to, the specific design of the stormwater management measures, the maintenance actions, the access and disturbance, the disposal methods, the location of disposal, the method to empty a basin, the method to dredge the basin, the pollutants in the basin, the damages to the basin, and the method to repair the basin.

Check Maintenance Guidance in NJDEP Stormwater Management Website for details and links to the relevant permits and program areas (http://www.njstormwater.org).

Safety Regulations and Requirements

As per NJDEP BMP Manual Ch. 8 (Feb., 2004), all local ordinances and state and federal regulations regarding occupational safety should be included in this Maintenance Plan.

Devices/Tools/Equipment Operation and Maintenance Manual and Warranties As per NJDEP BMP Manual Ch. 8 (Feb., 2004), maintenance, repair, and replacement instructions for specialized, proprietary, and nonstandard equipment, tools, supplies, manufacturers' product instructions, and user manuals should be included in this Maintenance Plan.



PART II - FIELD MANUALS

Attachment of Field Manuals for Stormwater Management Measures on this Site

As per N.J.A.C. 7:8-5.8(b)&(e), preventative and corrective maintenance shall be performed to maintain the function of stormwater management measures, including repair or replacement of the structure; removal of sediment, debris or trash; restoration of eroded areas; snow and ice removal; fence repair or replacement; restoration of vegetation; repair or replacement of non-vegetated linings, and removal of rodent/wildlife and repair/restoration to damaged affected areas caused by them.

Each Field Manual attached to this Maintenance Plan is a separate document pertaining to one specific stormwater management measure, and should be used by inspections and maintenance crews in order to carry out the maintenance work required by N.J.A.C. 7:8-5.8(e). Design engineers should prepare the field manuals in accordance with the design of each measure and the specific requirements of the site. See the sample field manuals for further guidance.

Field Manual for <u>Surface Infiltration Basin (SWM-A)</u>
Field Manual for <u>Surface Infiltration Basin (SWM-B1)</u>
Field Manual for <u>Surface Infiltration Basin (SWM-B2)</u>
Field Manual for <u>Surface Infiltration Basin (SWM-D)</u>
Field Manual for <u>Surface Infiltration Basin (SWM-G1)</u>
Field Manual for <u>Surface Infiltration Basin (SWM-H)</u>



Maintenance Logs and Inspection Records

As per N.J.A.C. 7:8-5.8(e), preventative and corrective maintenance shall be performed to maintain the function of the stormwater management measure(s), including repairs or replacement to the structure; removal of sediment, debris, or trash; restoration of eroded areas; snow and ice removal; fence repair or replacement; restoration of vegetation; and repair or replacement of non-vegetated linings.

As per N.J.A.C. 7:8-5.8(f), the person responsible for maintenance shall maintain a detailed log of all preventative and corrective maintenance for the structural stormwater management measures incorporated into the design of the development, including a record of all inspections and copies of all maintenance-related work orders.

The responsible party shall maintain a record of all maintenance actions performed, including:

- Inspection checklists from each performed inspection
- Preventative maintenance logs
- Corrective maintenance logs, including work orders
- Other maintenance records



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-A

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 419,229.886; N(Y):797,322.43

Location Description: Southern Section of Site

Location Map

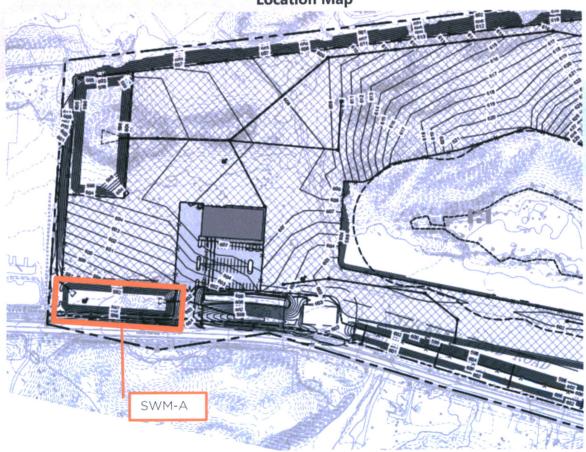




TABLE OF CONTENTS

1	Surface Infiltration Basin Overview	2
	Basin Design Information	
	Visual Aid For Dry Type Stormwater Basin Inspection	
4.	Reference Documents	.10
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin	11
6.	Preventative Maintenance Record	.16
7.	Corrective Maintenance Record	. 17



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- This basin is designed with a subsoil permeability rate of <u>5.0</u> inches/hour (pre-construction) and _____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 1.2 hours hours (Water Quality Storm)
 - b. 3.5 Hours (2 Year Storm)

 - c. 5.2 Hours (10 Year Storm)d. 8.5 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 588.86 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- 1. This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 84,372 cubic feet of runoff.
- The water surface elevation is at EL. 592.76 feet.
- 3. The 100-year storm water surface elevation is at EL. 595.05
- 4. The emergency spillway is at EL. 596.25 feet.

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 5,318.5 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 591.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



VISUAL AID FOR DRY TYPE 3. STORMWATER BASIN INSPECTION



Issue:

The inlet is not properly drained, assuming it has not rained within

72 hours.

Clear and remove sediment. Check whether the water table is at or above the bottom of the forebay. Also check the permeability Corrective Action:

of the underlying soil, if necessary.

Routine inspections and removal of sediment from the forebay. Preventative Action:





Issue: The Inflow pipe is clogged by sediment and vegetation.

Corrective Action: Clear and remove sediment and unwanted vegetation.

Preventative Action: Routine inspection and removal of sediment and unwanted vegetation.



Issue: The Inflow pipe is entirely clogged by sediment and trees.

Corrective Action: Clear and remove sediment and trees.

Preventative Action: Routine inspection & removal of sediment and unwanted

vegetation.





The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive

vegetation and overgrown trees.

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin

bottom.

Preventative Action: Routine inspection and removal of sediment and unwanted

vegetation.





Issue:

Eroded inflow apron.

Corrective Action:

Repair apron.

Preventative Action:

Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent Issue: inundation.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and tilling/aeration, if necessary.



Issue: The low flow channel has excessive accumulation of sediment and

debris. The outflow orifice is clogged by a trash bag and debris.

Note that there is no trash rack installed.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Issue:

Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quarterly	/ Annual / Monthly / Special Event Inspection
Checklist No.	Inspection Date:
Date of most r	ecent rain event:
	Condition (circle one): Downpour / Other
	Condition (circle one): / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



	For Inspector			For Maintenance Crew
	1	Standing water is present after the design drain time The observed drain time is approximately hours.	Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #
	2	Excessive sediment, silt, or trash accumulation on basin bed	Y N	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #
A Infiltration Bed	3	Erosion or channelization is present	Y N	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development
Note:				



			For Inspector		For Maintenance Crew			
		1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #			
B Vegetation		2	Overgrown vegetation	Y N	Mow/trim the vegetation Work Order #			
		3	Tree growth in the basin	Y N	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural damage Work Order #			
Note:								



			For Inspector	For Maintenance Crew		
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #	
E Emergency		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #	
Spillwa		2	Damaged structure	Y N	Repair Work Order #	
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #	
F Miscellan	eous	4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #	

Note:



Follow Up Items (Component No. / Inspection Item No.):											
Associated Work Orders: #	,#	,#	,#	, #							
Inspector Name		Signature		Date							
Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.											

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corres Component N	ponding Checklist No o, Inspection Item No	
Work Logs		
Activities	Components	Date Completed
Sediment/debris removal Sediment removal should	A - Basin Bed	
be taken place when the	C - Basin Embankment and Side Slopes	
basin is thoroughly dry	D - Outlet	
basin is thereaging any		
3.7	A - Basin Bed	
	C - Basin Embankment and Side Slopes	
Vegetation removal	C - Outlet	
	E - Emergency Spillway	
remaining vegetation. All use of fertilizers, pest ensure optimum vegetation of the stormwater magnitude, and	y with minimum disruption to icides, mechanical treatments, and other means health must not compromise the intended purnagement measure. The fertilizer applied is applied trash are handled (onsite / by). (See Page 2.1)	ns to rpose ed is
Maintenance Plan - Dispos		
Crew member:		

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.



Supervisor: _

CORRECTIVE MAINTENANCE RECORD 7.

	1.	Wo Dat	rk Order # e Issued		_ _			
	2.	. Issue to be resolved:						
	3. The issue was from Corresponding Checklist, Component No, Inspection Item No							
	4.	Actio	uired Actions	Planned Date	Date Completed			
	,	VO CITO		TIGHTOG BUTC				
	5. Responsible person(s):							
	6.	Spe	ecial requirem Time of the se	ents eason or weather condit	ion			
		0	Tools/equipn	nent:				
		0	Subcontracto	or (name or specific type	e):			
Approv	vec	l by		// (name/signa	ture) Date			
Verifica	atic	on of	completion b	ру/	Date e/signature)			
File th	nis	Cor	rective Main aintenance.	tenance Record in th	ne Maintenance Log after			



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-B1

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 420,540.19; N(Y):798,325.44

Location Description: MIddle Section of Site

Location Map

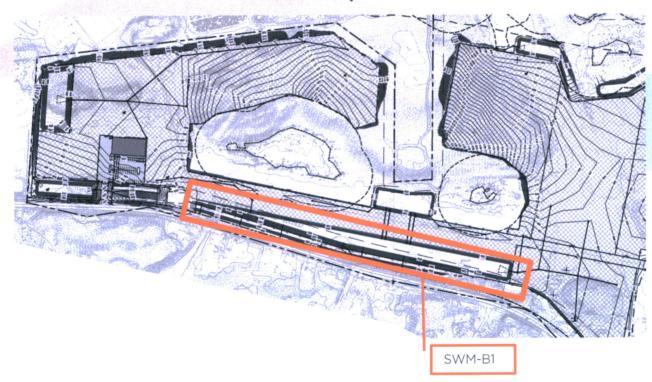




TABLE OF CONTENTS

1.	Surface Infiltration Basin Overview	2
2.	Basin Design Information	3
3.	Visual Aid For Dry Type Stormwater Basin Inspection	. 4
4.	Reference Documents	10
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin	. 11
6.	Preventative Maintenance Record	16
7.	Corrective Maintenance Record	17



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- This basin is designed with a subsoil permeability rate of 5.0inches/hour (pre-construction) and _____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 1.1 hours hours (Water Quality Storm)
 - b. 3.6 Hours (2 Year Storm)

 - c. 5.7 Hours (10 Year Storm) d. 9.7 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 596.21 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- 1. This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 495,143 cubic feet of runoff.
- The water surface elevation is at EL. 598.62 feet.
- 3. The 100-year storm water surface elevation is at EL. 601.18
- 4. The basin has been designed to work as an interconnected pond with the downstream basin SWM-B2, connected through a set of pipes at 0.0% slopes.

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 30,629 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 597.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- 1. No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



3. VISUAL AID FOR DRY TYPE STORMWATER BASIN INSPECTION



Issue:

The inlet is not properly drained, assuming it has not rained within

72 hours.

Corrective Action:

Clear and remove sediment. Check whether the water table is at or above the bottom of the forebay. Also check the permeability

of the underlying soil, if necessary.

Preventative Action:

Routine inspections and removal of sediment from the forebay.





Issue: The Inflow pipe is clogged by sediment and vegetation.

Corrective Action: Clear and remove sediment and unwanted vegetation.

Preventative Action: Routine inspection and removal of sediment and unwanted vegetation.



Issue: The Inflow pipe is entirely clogged by sediment and trees.

Corrective Action: Clear and remove sediment and trees.

Preventative Action: Routine inspection & removal of sediment and unwanted

vegetation.





The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive

vegetation and overgrown trees.

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin

bottom.

Preventative Action: Routine inspection and removal of sediment and unwanted

vegetation.





Issue:

Eroded inflow apron.

Corrective Action:

Repair apron.

Preventative Action:

Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent Issue:

inundation.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and tilling/aeration, if necessary.



Issue: The low flow channel has excessive accumulation of sediment and

debris. The outflow orifice is clogged by a trash bag and debris. Note that there is no trash rack installed.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Issue:

Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quarter	ly / Annual / Monthly / Special Event Inspection
Checklist No.	Inspection Date:
Date of most	recent rain event:
	Condition (circle one): / Downpour / Other
	d Condition (circle one): ng / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



		For Inspector		For Maintenance Crew
	1	Standing water is present after the design drain time The observed drain time is approximately hours.	Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #
A Infiltration Bed	2	Excessive sediment, silt, or trash accumulation on basin bed	Y N	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #
	3	Erosion or channelization is present	Y N	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development
Note:	2			



	For Inspector For Maintenance Crew						
			For Inspector	For Maintenance Crew			
		1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #		
B Vegetation		2	Overgrown vegetation	Y N	Mow/trim the vegetation Work Order #		
		3	Tree growth in the basin	Y N	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural damage Work Order #		
Note:							



	For Inspector For Maintenance Crew					
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #	
E Emergency Spillway		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #	
		2	Damaged structure	Y N	Repair Work Order #	
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #	
F Miscellan	eous	4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #	



Follow Up Items (Component No. /	inspection item No.,	
Associated Work Orders: #	, #, #	, #, #
Inspector Name	Signature	Date

Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corresponding Checklist No. _____

Component N	o, Inspection Item No	
Work Logs		
Activities	Components	Date Complete
Sediment/debris removal Sediment removal should	A - Basin Bed	
be taken place when the	C - Basin Embankment and Side Slopes	
basin is thoroughly dry	D - Outlet	
	A - Basin Bed	
	C - Basin Embankment and Side Slopes	
Vegetation removal	C - Outlet	
	E - Emergency Spillway	
remaining vegetation. All use of fertilizers, pesti ensure optimum vegetatio of the stormwater ma	with minimum disruption to with minimum disruption to cides, mechanical treatments, and other mean health must not compromise the intended purpose applies applies.	ans to urpose
, and	is applied	

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.

Debris, sediment, and trash are handled (onsite / by (contractor name) to disposal site ______). (See Part I: Maintenance Plan - Disposal Plan Section)

/_____(name/ signature)

(name/ signature)

_ Date: _____



Crew member: __

Supervisor: _

7. **CORRECTIVE MAINTENANCE RECORD**

	1.	Wo Da	ork Order # te Issued	7				
	2.	lss	ue to be resolv	ved:				
	3.	Th No	e issue was , Inspecti	from Corresponding on Item No	Checklist,	Component		
	4.	Re	quired Actions	s				
			ons	Planned Date	Date Complet	ed		
	5. Responsible person(s):							
	6.		ecial requirement Time of the se	ents eason or weather condi	tion			
		0	Tools/equipm	nent:				
				or (name or specific typ				
Approv	ved	by		/	Date			
Verifica	atio	n of	completion b	y/(nam	Date			
File th	าเร	Cor	rective Maint aintenance.	(nam renance Record in t	ne/signature) he Maintenance	Log after		



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-B2

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 420,387.26; N(Y):798,476.15

Location Description: Middle Section of Site

Location Map

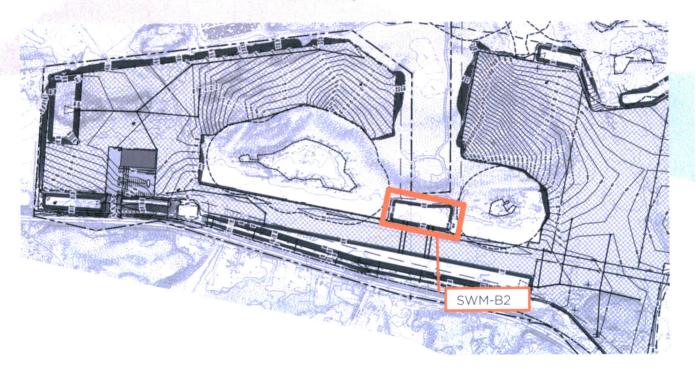




TABLE OF CONTENTS

1.	Surface Infiltration Basin Overview	.2
2.	Basin Design Information	3
3.	Visual Aid For Dry Type Stormwater Basin Inspection	4
4.	Reference Documents	10
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin	11
6.	Preventative Maintenance Record	16
7	Corrective Maintenance Record	17



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- 1. This basin is designed with a subsoil permeability rate of 5.0 inches/hour (pre-construction) and ____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 0.8 hours hours (Water Quality Storm)

 - b. 2.4 Hours (2 Year Storm) c. 3.7 Hours (10 Year Storm) d. 6.2 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 596.21 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- 1. This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 109,871 cubic feet of runoff.
- The water surface elevation is at EL. 598.46 feet.
- 3. The 100-year storm water surface elevation is at EL. 600.77
- 4. The basin has been designed to work as an interconnected pond with the upstream basin SWM-B1, connected through a set of pipes at 0.0% slopes.
- 5. The emergency spillway elevation is at EL. 601.50

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 10,592 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 597.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- 1. No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



3. VISUAL AID FOR DRY TYPE STORMWATER BASIN INSPECTION



Issue: The inlet is not properly drained, assuming it has not rained within

72 hours.

Corrective Action: Clear and remove sediment. Check whether the water table is at

or above the bottom of the forebay. Also check the permeability

of the underlying soil, if necessary.

Preventative Action: Routine inspections and removal of sediment from the forebay.





The Inflow pipe is clogged by sediment and vegetation. Issue:

Clear and remove sediment and unwanted vegetation. Corrective Action:

Routine inspection and removal of sediment and unwanted Preventative Action: vegetation.



The Inflow pipe is entirely clogged by sediment and trees. Issue:

Clear and remove sediment and trees. Corrective Action:

Routine inspection & removal of sediment and unwanted Preventative Action:

vegetation.





The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive

vegetation and overgrown trees.

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin

bottom.

Preventative Action: Routine inspection and removal of sediment and unwanted

vegetation.





Issue:

Eroded inflow apron.

Corrective Action:

Repair apron.

Preventative Action:

Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent

inundation. Issue:

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Routine inspection and tilling/aeration, if necessary. Preventative Action:



The low flow channel has excessive accumulation of sediment and debris. The outflow orifice is clogged by a trash bag and debris. Issue:

Note that there is no trash rack installed.

Check the permeability rate of the soil and the water table elevation. Corrective Action:

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Issue:

Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quar	terly / Annual / Monthly / Special Event Inspection
Checklist No	Inspection Date:
Date of mo	ost recent rain event:
	ain Condition (circle one): er / Downpour / Other
Gro Dry / Moist / Pon	ound Condition (circle one): ading / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



	For Inspector For Maint			For Maintenance Crew	
A Infiltration Bed	1	Standing water is present after the design drain time The observed drain time is approximately hours.	Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #	
	2	Excessive sediment, silt, or trash accumulation on basin bed	Y	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #	
	3	Erosion or channelization is present	Y N	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #_	
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #	
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #	
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development	
Note:				•	



		-	For Inspector		For Maintenance Crew	
	ė	1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #	
B Vegeta	tion	2	Overgrown vegetation	Y N	Mow/trim the vegetation Work Order #	
		3	Tree growth in the basin	Y N	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural damage	
					Work Order #	
Note:						



			For Inspector		For Maintenance Crew	
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #	
E Emergency Spillway		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #	
		2	Damaged structure	Y N	Repair Work Order #	
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #	
F Miscellaneous		4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #	

E&LP

Follow Up Items (Component No. / Inspection Item No.):							
Associated Work Orders: #	_, #	#	_, #	, #			
Inspector Name	Signa	ture		Date			

Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corres Component N	sponding Checklist No o, Inspection Item No	
Work Logs		
Activities	Components	Date Completed
Sediment/debris removal	A - Basin Bed	
Sediment removal should	C - Basin Embankment and Side Slopes	
be taken place when the	D - Outlet	
basin is thoroughly dry	D - Odtiet	
	A - Basin Bed	
165		
Vegetation removal	C - Basin Embankment and Side Slopes C - Outlet	
	E - Emergency Spillway	
remaining vegetation. All use of fertilizers, pest ensure optimum vegetation of the stormwater magnetic period of the stormwater period of th	with minimum disruption to icides, mechanical treatments, and other mean health must not compromise the intended purpose is applied trash are handled (onsite / by). (See Page 1.5]	ns to rpose ed is
Maintenance Plan - Dispos	sal Plan Section)	
Crew member:		
Supervisor:		

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.



7. CORRECTIVE MAINTENANCE RECORD

	1. W	ork Order # ate Issued		_
	2. Is s	sue to be resolv	ved:	
	3. Th	ne issue was o, Inspectio	from Corresponding on Item No	Checklist, Component
	4. Re	equired Actions	5	
[Act	ions	Planned Date	Date Completed
	k i j			
7419	a programme			
	5. R (esponsible pers	son(s):	
	6. S r	pecial requirem Time of the se	ents eason or weather conditi	on
	0	Tools/equipn	nent:	
	0	Subcontracto	or (name or specific type):
Approv	ed by	<i>'</i>	/	cure) Date
Verifica	ition o	of completion b	у//	Date e/signature)
File th	is Co	orrective Maint naintenance.	tenance Record in th	e Maintenance Log after



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-D

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 418,911.61; N(Y):797,593.22

Location Description: Southwestern Section of Site

Location Map

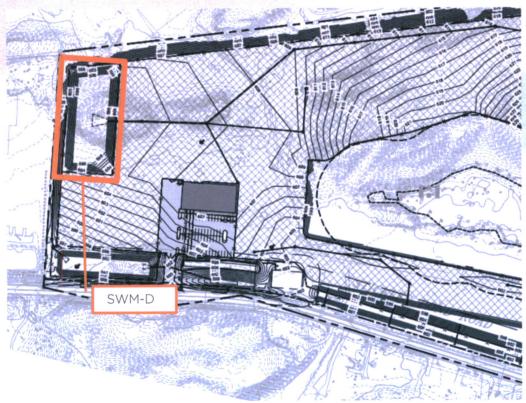




TABLE OF CONTENTS

1.	Surface Infiltration Basin Overview	.2
2.	Basin Design Information	.3
3.	Visual Aid For Dry Type Stormwater Basin Inspection	4
4.	Reference Documents	0
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin	11
6.	Preventative Maintenance Record	6
7	Corrective Maintenance Record	17



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- 1. This basin is designed with a subsoil permeability rate of 5.0inches/hour (pre-construction) and _____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 1.7 Hours (Water Quality Storm)
 - b. 5.1 Hours (2 Year Storm)

 - c. 7.7 Hours (10 Year Storm) d. 12.5 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 589.59 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- 1. This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 339,491 cubic feet of runoff.
- 2. The water surface elevation is at EL. 599.41 feet.
- 3. The 100-year storm water surface elevation is at EL. 604.11
- 4. The emergency spillway elevation is at EL. 604.50

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 11,884 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 597.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- 1. No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



3. VISUAL AID FOR DRY TYPE STORMWATER BASIN INSPECTION



Issue:

The inlet is not properly drained, assuming it has not rained within 72 hours.

Corrective Action:

Clear and remove sediment. Check whether the water table is at or above the bottom of the forebay. Also check the permeability of the underlying soil, if necessary.

Preventative Action:

Routine inspections and removal of sediment from the forebay.





Issue: The Inflow pipe is clogged by sediment and vegetation.

Corrective Action: Clear and remove sediment and unwanted vegetation.

Preventative Action: Routine inspection and removal of sediment and unwanted vegetation.



Issue: The Inflow pipe is entirely clogged by sediment and trees.

Corrective Action: Clear and remove sediment and trees.

Preventative Action: Routine inspection & removal of sediment and unwanted

vegetation.





The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive vegetation and overgrown trees.

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin bottom.

Preventative Action: Routine inspection and removal of sediment and unwanted vegetation.





Issue:

Eroded inflow apron.

Corrective Action:

Repair apron.

Preventative Action:

Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent

Issue: inundation.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and tilling/aeration, if necessary.



Issue: The low flow channel has excessive accumulation of sediment and

debris. The outflow orifice is clogged by a trash bag and debris.

Note that there is no trash rack installed.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Issue:

Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quarter	ly / Annual / Monthly / Special Event Inspection
Checklist No.	Inspection Date:
Date of most	recent rain event:
	Condition (circle one): Downpour / Other
	d Condition (circle one): ng / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



For Inspector For Maintenance Crew					
	1	Standing water is present after the design drain time The observed drain time is approximately hours.	Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #	
A Infiltration Bed	2	Excessive sediment, silt, or trash accumulation on basin bed	Y N	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #	
	3	Erosion or channelization is present	Y N	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #	
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #	
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #	
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development	
Note:				-	



			For Inspector		For Maintenance Crew
		1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #
B Vegetation	ation	2	Overgrown vegetation	Z	Mow/trim the vegetation Work Order #
		3	Tree growth in the basin	Y	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural damage
en in per consumption because it					Work Order #
Note:		•			



			For Inspector		For Maintenance Crew
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #
E Emergency Spillway		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #
		2	Damaged structure	Y N	Repair Work Order #
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #
F Miscellanec	ous	4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #

E&LP

Follow Up Items (Component N	vo. / Inspection item	140.).	
Associated Work Orders: #	,#,#	, #	, #
Inspector Name	Signature	_	Date

Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corresponding Checklist No. _

	Component N	o, Inspection Item No	
	Work Logs		
	Activities	Components	Date Comple
	Sediment/debris removal Sediment removal should	A - Basin Bed	
	be taken place when the	C - Basin Embankment and Side Slopes	
	basin is thoroughly dry	D - Outlet	
- 7			
		A - Basin Bed	
	Vanatatian nanawal	C - Basin Embankment and Side Slopes	
Vegetation removal	vegetation removal	C - Outlet	
		E - Emergency Spillway	
	All use of fertilizers, pest ensure optimum vegetatio of the stormwater ma	with minimum disruption to with minimum disruption to with minimum disruption to with the control of the contro	ns to rpose
	Debris, sediment, and (contractor name) to d Maintenance Plan - Dispos	trash are handled (onsite / by). (See Pasal Plan Section)	art 1:

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.

(name/ signature)

_ Date: __



Crew member: _

Supervisor:

7. CORRECTIVE MAINTENANCE RECORD

1. Work Order # _____

	Dat	te Issued			_	
2	2. Issu	ue to be resolv	ved:			
3	3. The	e issue was , Inspection	from Corr on Item No.	esponding 	Checklist,	Component
_	4. Red	quired Actions				
		ons	Planned Da	ate	Date Complet	:ed
					· A	
Ĺ	5. Re :	sponsible pers	son(s):			
(6. Sp e	ecial requirem Time of the se	ents eason or we	ather condit	ion	
	0	Tools/equipm	nent:			
	0	Subcontracto	or (name or s	specific type	e):	
Approv	ed by			name/signat	Date	
Verifica	tion of	completion b	у	/	Date	
File thi	s Cor			(IIIIII)	e/signature) e Maintenance	



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-B2

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 420,353.378; N(Y):799,480.665

Location Description: Northern Section of Site

Location Map

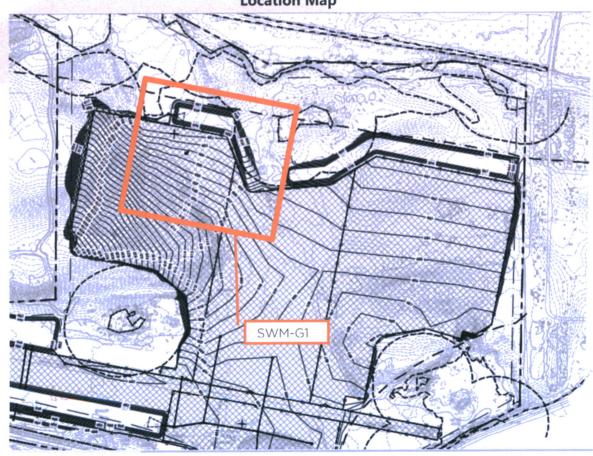




TABLE OF CONTENTS

1.	Surface Infiltration Basin Overview	2
	Basin Design Information	
	Visual Aid For Dry Type Stormwater Basin Inspection	
4.	Reference Documents	.10
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin	11
6.	Preventative Maintenance Record	. 16
7	Corrective Maintenance Record	. 17



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- This basin is designed with a subsoil permeability rate of 5.0inches/hour (pre-construction) and _____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 2.0 Hours (Water Quality Storm)
 b. 6.1 Hours (2 Year Storm)
 c. 9.4 Hours (10 Year Storm)
 d. 15.7 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 592.64 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 160,626 cubic feet of runoff.
- 2. The water surface elevation is at EL. 597.21 feet.
- 3. The 100-year storm water surface elevation is at EL. 600.64
- 4. The emergency spillway elevation is at EL. 600.70

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 5,469.5 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 595.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- 1. No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



3. VISUAL AID FOR DRY TYPE STORMWATER BASIN INSPECTION



Issue: The inlet is not properly drained, assuming it has not rained within 72 hours.

Corrective Action: Clear and remove sediment. Check whether the water table is at

or above the bottom of the forebay. Also check the permeability

of the underlying soil, if necessary.

Preventative Action: Routine inspections and removal of sediment from the forebay.





Issue: The Inflow pipe is clogged by sediment and vegetation.

Corrective Action: Clear and remove sediment and unwanted vegetation.

Preventative Action: Routine inspection and removal of sediment and unwanted vegetation.



Issue: The Inflow pipe is entirely clogged by sediment and trees.

Corrective Action: Clear and remove sediment and trees.

Preventative Action: Routine inspection & removal of sediment and unwanted

vegetation.





Issue:

The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive vegetation and overgrown trees.

Corrective Action:

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin bottom.

Preventative Action:

Routine inspection and removal of sediment and unwanted vegetation.





Issue: Eroded inflow apron.

Corrective Action: Repair apron.

Preventative Action: Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent

inundation.

Issue:

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Routine inspection and tilling/aeration, if necessary. Preventative Action:



The low flow channel has excessive accumulation of sediment and debris. The outflow orifice is clogged by a trash bag and debris. Issue:

Note that there is no trash rack installed.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Issue:

Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quarterly	/ Annual / Monthly / Special Event Inspection
Checklist No.	Inspection Date:
Date of most re	ecent rain event:
	ondition (circle one): ownpour / Other
Ground (Dry / Moist / Ponding	Condition (circle one): / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



		For Inspector		For Maintenance Crew
A Infiltration Bed	1	Standing water is present after the design drain time The observed drain time is approximately hours.	Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #
	2	Excessive sediment, silt, or trash accumulation on basin bed	Y N	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #
	3	Erosion or channelization is present	YN	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development
Note:				



	For Inspector For Maintenance Crew					
		1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #	
B Vegetation		2	Overgrown vegetation	Y N	Mow/trim the vegetation Work Order #	
		3	Tree growth in the basin	Y N	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural damage	
	, da 1, ga 1, g				Work Order #	
Note:						



			For Inspector	For Maintenance Crew		
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #	
E Emergency Spillway		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #	
		2	Damaged structure	Y N	Repair Work Order #	
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #	
F Miscellaneous Note:		4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #	

Note:



Follow Up Items (Component No	o. / Inspe	ction Item	No.):	
Associated Work Orders: #	,#	, #	, #	, #
Inspector Name	S	Signature		Date

Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corresponding Checklist No. _

Component N	lo, Inspection Item No				
Work Logs					
Activities	Components	Date Completed			
Sediment/debris removal Sediment removal should	A - Basin Bed				
be taken place when the	C - Basin Embankment and Side Slopes				
basin is thoroughly dry	D - Outlet				
	A - Basin Bed				
	C - Basin Embankment and Side Slopes				
Vegetation removal	C - Outlet				
	E - Emergency Spillway				
Vegetation is removed by with minimum disruption to the remaining vegetation. All use of fertilizers, pesticides, mechanical treatments, and other means to ensure optimum vegetation health must not compromise the intended purpose of the stormwater management measure. The fertilizer applied is is applied Debris, sediment, and trash are handled (onsite / by (contractor name) to disposal site). (See Part I: Maintenance Plan - Disposal Plan Section)					
Crew member:	Date:				
Supervisor:					

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.



7. CORRECTIVE MAINTENANCE RECORD

1. Work Order # _____

		Da	te Issued			_	
	2.	Issi	ue to be resolv	ved:			
	3.	The No	e issue was , Inspection	from Correspo on Item No	nding	Checklist,	Component
	4. Required Actions						
			ons	Planned Date		Date Complet	ted
			ja Ja				
		as the See Section					
	5.	Re	sponsible pers	son(s):			
	6.	Spe	ecial requirem Time of the se	ents eason or weather	conditi	on	
		0	Tools/equipn	nent:			
				or (name or speci			
Appro	ovec	by		/	/signat	Date	
Verific	catio	on of	completion b	у/	(n====	Date	
File t	this	Cor	rective Maint aintenance.	tenance Record	in th	e Maintenanco	e Log after



SURFACE INFILTRATION BASIN FIELD MANUAL: SWM-G1

Development Name: 248 Stickles Pond Road

Township, County: Andover Township, Sussex County, New Jersey

Location of Basin: E(X): 420,896.96; N(Y):799,928.706

Location Description: Northern Section of Site

Location Map





TABLE OF CONTENTS

1.	Surface Infiltration Basin Overview2
2.	Basin Design Information3
3.	Visual Aid For Dry Type Stormwater Basin Inspection4
4.	Reference Documents
5.	Inspection Checklist / Maintenance Actions For Surface Infiltration Basin 11
6.	Preventative Maintenance Record16
7	Corrective Maintenance Record



SURFACE INFILTRATION BASIN OVERVIEW

Functionality

An infiltration basin is a stormwater management facility constructed of highly permeable soils, which provides temporary storage of stormwater runoff. Infiltration basins are used to remove pollutants and to infiltrate stormwater. In addition to pollutant removal and groundwater recharge, infiltration may help to reduce increases in both the peak rate and total runoff volume caused by land development. Pollutant removal is achieved through filtration of the runoff through the soil, as well as biological and chemical activity within the soil. The total suspended solids (TSS) removal rate attributed to infiltration basins is 80%.

Proper care and attention in the long-term maintenance of the stormwater management measure is critically important to the safety and health of the public.

Type of BMP - Dry Basin / Infiltration Only

An infiltration basin is a type of *dry* basin. Dry basins must fully drain within 72 hours of the most recent rainfall. Standing water in excess of 72 hours is a sign of basin failure. It may also contribute to mosquito breeding and other health and safety issues. The design drain time shall be closely monitored to ensure that potential failure is recognized early.

This surface infiltration basin is designed for **infiltration only** and is **not** designed for extended detention.



BASIN DESIGN INFORMATION 2.

Hydrology Design Targets:

- 1. This basin is designed with a subsoil permeability rate of 5.0inches/hour (pre-construction) and _____ inches/hour (postconstruction)
- 2. The design drain time is:
 - a. 1.2 Hours (Water Quality Storm)
 b. 3.7 Hours (2 Year Storm)
 c. 5.7 Hours (10 Year Storm)

 - d. 9.7 Hours (100 Year Storm)
- 3. The elevation of the seasonal high-water table of this basin was observed on 10/15/2019 and it was below the basin bottom surface, at EL. greater than 589.44 feet.
- 4. This basin will be discharged to the subsoil through exfiltration.

Hydraulic Design Targets:

- 1. This basin is designed to infiltrate the runoff from the 100-Year Design storm, which generates 324,029 cubic feet of runoff.
- 2. The water surface elevation is at EL. 596.75 feet.
- 3. The 100-year storm water surface elevation is at EL. 599.63.
- 4. The emergency spillway elevation is at EL. 599.75

Basin Configuration Targets:

- 1. The basin bottom is covered by a sand layer.
 - The depth of the sand layer is 6 inches, which requires a volume of 17,863 cubic feet of sand.
 - The invert elevation of the sand layer is EL. 595.50 feet
 - The sand layer is designed to be replaced every 24 months.
- 2. Vegetation
 - The top of sand bed has been designed to have no vegetation. The side slopes of the basin are to be seeded

Critical Maintenance Features:

- 1. No heavy equipment on the basin surface or sand layer.
- 2. Trash racks and discharge outlet shall be cleaned frequently.
- 3. Grass clipping shall be collected from the basin and properly disposed.



3. VISUAL AID FOR DRY TYPE STORMWATER BASIN INSPECTION



Issue:

The inlet is not properly drained, assuming it has not rained within 72 hours.

Corrective Action:

Clear and remove sediment. Check whether the water table is at or above the bottom of the forebay. Also check the permeability of the underlying soil, if necessary.

Preventative Action:

Routine inspections and removal of sediment from the forebay.





The Inflow pipe is clogged by sediment and vegetation.

Corrective Action:

Clear and remove sediment and unwanted vegetation.

Preventative Action:

Routine inspection and removal of sediment and unwanted vegetation.



Issue:

The Inflow pipe is entirely clogged by sediment and trees.

Corrective Action:

Clear and remove sediment and trees.

Preventative Action:

Routine inspection & removal of sediment and unwanted vegetation.





The excessive sediment in inflow pipe (shown above) might be caused by a blockage of flow to the basin due to excessive vegetation and overgrown trees.

Corrective Action:

Clear and remove trees and vegetation. If necessary, re-grade the bottom slope to ensure the flow properly spreads over the basin bottom.

Preventative Action:

Routine inspection and removal of sediment and unwanted vegetation.





Eroded inflow apron.

Corrective Action:

Repair apron.

Preventative Action:

Routine inspection and rehabilitation, if necessary.





The vegetation loss and the blackish soil may indicate frequent

inundation.

Issue:

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and tilling/aeration, if necessary.



Issue: The low flow channel has excessive accumulation of sediment and

debris. The outflow orifice is clogged by a trash bag and debris.

Note that there is no trash rack installed.

Corrective Action: Check the permeability rate of the soil and the water table elevation.

Replace the soil if necessary.

Preventative Action: Routine inspection and cleaning.





Trash rack is damaged.

Corrective Action:

Repair the trash rack.

Preventative Action:

Routine inspection, especially after large storm events. Tighten any loose bolts and repair structural flaws.





A well-maintained detention basin

4. REFERENCE DOCUMENTS

Documents to be placed in this field manual should include the following:

- As-built Drawings with Drainage Plans
- Soil Boring Logs



5. INSPECTION CHECKLIST / MAINTENANCE ACTIONS FOR SURFACE INFILTRATION BASIN

Checklist (circle one): Quarterly	/ Annual / Monthly / Special Event Inspection
Checklist No.	Inspection Date:
Date of most r	ecent rain event:
	Condition (circle one): Downpour / Other
	Condition (circle one): y / Submerged / Snow accumulation

The inspection items and preventative/corrective maintenance actions listed below represent general requirements. The design engineer and/or responsible party shall adjust the items and actions to better meet the conditions of the site, the specific design targets, and the requirements of regulatory authorities.



	For Inspector For Maintenance Crew			For Maintenance Crew
	Standing water is present after the design drain time		Y N	Recheck to determine if there is standing water after 72 hours. If standing water is present longer than 5 days, report to mosquito commission. Remove any sediment buildup. Replace the sand layer. Work Order #
A Infiltration Bed	2	Excessive sediment, silt, or trash accumulation on basin bed	Y N	Clean pretreatment system. Remove silt, sediment, and trash. Work Order #
	3	Erosion or channelization is present	Y N	Check whether the flow bypass or diversion device is clogged. Re-grade the infiltration bed. Work Order #
	4	Animal burrows/rodents are present	Y N	Pest control. Work Order #
	5	Uneven bed	Y N	Use light equipment to resurface the bed. Work Order #
	6	Evidence of sinkholes or subsidence	Y N	Monitor for sinkhole development
Note:				



		For Inspector			For Maintenance Crew
		1	Large spot(s) showing bare soil	Y N	Vegetative cover must be maintained at 85%. Revegetate the entire basin if 50% or more vegetation has been lost Check Landscaping plan for guidance (if available) Work Order #
B Vegetation		2	Overgrown vegetation	Y	Mow/trim the vegetation Work Order #
		3	Tree growth in the basin	Y	Clear, trim, or prune the trees according to the original Landscaping Plan Inspect to determine if the tree roots caused any structural
Note:					damage Work Order #



			For Inspector		For Maintenance Crew
C Basin Embankment and Side Slopes		1	Signs of erosion, soil slide or bulges, seeps and wet spots, loss of vegetation, or erosion on the basin slope	Y N	Check for excessive overland runoff flow through the embankment. Check for any sink hole development Direct the overland runoff to the forebay or pretreatment area Re-stabilize the bank Work Order #
E Emergency Spillway		1	Trees or excessive vegetation present	Y N	Remove trees and roots, and restore berms if necessary Work Order #
		2	Damaged structure	Y N	Repair Work Order #
		1	Fence: broken or eroded parts	Y N	Repair or replace Work Order #
F Miscellar	neous	4	Excessive or overgrown vegetation blocking access to the basin	Y N	Clear, trim, or prune the vegetation to allow access for inspection and maintenance Work Order #

E&LP

10. / Inspec	ction Item	No.):	
,#	,#	,#	,#
S	ignature		Date
	,#		

Report issues to the local authority and mosquito commission as required by local ordinances and regulatory authorities.

File this checklist in the Maintenance Log after performing maintenance.



6. PREVENTATIVE MAINTENANCE RECORD

Corresponding Checklist No Component No, Inspection Item No				
Work Logs				
Activities	Components	Date Completed		
Sediment/debris removal Sediment removal should	A - Basin Bed			
be taken place when the	C - Basin Embankment and Side Slopes			
basin is thoroughly dry	D - Outlet			
200	A - Basin Bed			
V/	C - Basin Embankment and Side Slopes			
Vegetation removal	C - Outlet			
	E - Emergency Spillway			
Vegetation is removed by with minimum disruption to the				

Vegetation is removed by remaining vegetation.	with mil	nimum disruption to) the
All use of fertilizers, pestice ensure optimum vegetation of the stormwater man, and	health must not compromagement measure. The	nise the intended pur he fertilizer <mark>applie</mark>	pose
Debris, sediment, and tr (contractor name) to dis Maintenance Plan - Disposa	ash are handled (onsit posal site Plan Section)	te / by). (See Pa	irt I
Crew member:	/_ (name/ signature	Date:	
Supervisor:	/	Date:	

File this Preventative Maintenance Record in the Maintenance Log after performing maintenance.



7. CORRECTIVE MAINTENANCE RECORD

1.	Wo Dat	rk Order # e Issued		
2.	Issu	ue to be resolv	ved:	
3.	The No.	e issue was , Inspecti	from Corresponding on Item No	Checklist, Component
		quired Actions		
	Actio	ons	Planned Date	Date Completed
5.	Res	sponsible pers	son(s):	
6.	Spe	ecial requirem Time of the s	n <mark>ents</mark> eason or weather cond	lition
	0	Tools/equipr	ment:	
				oe):
				Date
Verification	on of	completion k	oy/	Date me/signature)
File this	Cor	rective Main aintenance.	tenance Record in	me/signature) the Maintenance Log after

